

ALTO MAIPO**OWNER'S INSTRUCTION**

Section 2.29

PHAM-PLN12-INS-0003



Contract



AM-CO610/620B



AM-CO630/620A

SI 6332/N° 0078

Scope Segment Description:

grouting

Scope Segment ID: 3.9.2

Location

V 5CH0 + 646,9


Time for Compliance:

Before next advance

Contractor shall immediately proceed with the Work described below, in accordance with the terms and conditions of the Contract. This instruction is limited to maximum of 1000 UF or USD \$ 50,000., and without impact on the lump sums or schedule (except for Equivalent Times in the BOQ).

Instruction:

The contractor is herewith instructed to drill three holes of 2.1 m length as indicated in the sketch, these holes shall be drilled in parallel to the tunnel as indicated in the sketch

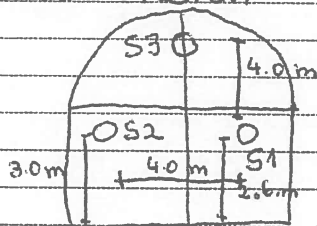

It shall be grouted as follows in the three holes indicated (S1, S2, S3)

Pressure 30 bars, it not pressure built up stop after full filling with

w/c Kg/cement

1,0 300

0,8 700

0,6 1000

If those holes give a lot of water. Stop and make a new full grout screen. (> 2.5 lt/s)

Owner estimate of impact is: Per Units in BOQ ☐ ; or cost

; &/or Time

If Contractor believes that this instruction constitutes a Change, Contractor shall promptly provide Notice according to Section 11 of the Contract.

Contractor comments (if any):

Issued by		Received by Contractor	
Carolina Saldaña		Juan Molina	
Sign:		Sign:	
Designation:	Geologist	Designation:	Geologist
Date:		Date:	06-09-15
Time:		Time:	

White (original): Contractor / Yellow (copy 1): OE/ Pink (copy 2): ITO